

DTF

Digital Torque Wrench

Operating Instructions





ELECTROMATIC Equip't Co., Inc.
600 Oakland Ave, Cedarhurst, NY 11516
Tel: 800-645-4330 / 516-295-4300
Web: www.CheckLine.com

Thank you!

Dear Customers,

Thank you for purchasing the DTF digital torque wrench. This instruction manual will help you to use the many features of your new digital torque wrench. Before operating the torque wrench, please read this manual completely, and keep it nearby for future reference.

NAMES & FUNCTIONS OF PARTS

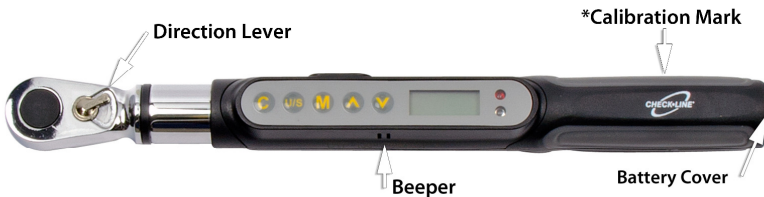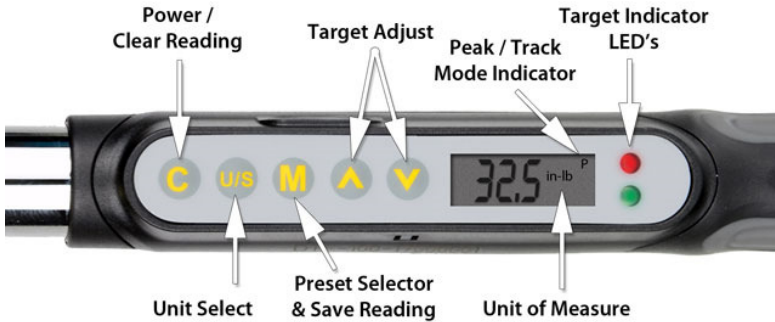

*The Calibration Mark is a small notch in the center of the handle to indicate where force should be applied when checking calibration accuracy.

SPECIFICATIONS

Accuracy*	Clockwise: $\pm 2\%$ Counter-Clockwise: $\pm 3\%$ From 20% to 100% of capacity, ± 1 least significant digit	
Capacity	DTF-50	DTF-100
	53 in-lb	106 in-lb
	4.4 lb-ft	8.8 lb-ft
	6 N-m	12 N-m
	61 kg-cm	122 kg-cm
Resolution	0.01 lb-in 0.001 lb-ft 0.001 Nm 0.01 kg-cm	0.1 lb-in 0.01 lb-ft 0.01 Nm 0.1 kg-cm
Presets	9 Programmable setpoints with both audible beep and Green/Red LED indicator	
Operating Modes	Peak and Track	
Drive	1/4 Inch - 6.35 mm Female Hex	
Power Supply	1x AAA Battery (included)	
Battery Life	12 Hours of continuous operation	
Auto Off	Automatic power off after 5 minutes of non-use	
Operating Temp.	-10°C - 60°C	
Storage Temp.	-20°C - 70°C	
Length	8 inches / 20 mm	
Warranty	1 Year	

BEFORE USING THE TORQUE WRENCH

Battery Installation

- Remove the battery cover
- Insert one (1) AAA batteries with positive end facing the front of the torque wrench
- Reinstall battery cover and rotate to lock it in place. Take care to line up arrows on cap and back of torque wrench when installing.



POWER ON AND RESETTING THE TORQUE WRENCH

- Press **C** to power on the torque wrench
- Press **C** to zero the torque wrench before use
- **NOTE:** After pressing **C** the target torque value will be displayed

ATTENTION:

1. If an external force is applied to the torque wrench during power-on or zeroing an initial torque offset will exist in memory.
2. The measuring unit and operating mode (track / peak) are stored in memory. Once set they will be permanently stored.

SLEEP MODE

The torque wrench will automatically go to sleep after 5 minutes of non-use. Press **C** to wake the torque wrench from sleep.

INSTALLING BITS

The DTF torque wrench uses standard 1/4" (6.35mm) hex bits. Push bit to install into drive, pull to remove.



SELECTING UNITS OF MEASURE

The DTF torque wrench can display measurements in Newton Meters (**N-m**), Pound-Inch (**lb-in**), Pound-Foot (**lb-ft**) and Kilogram Centimeter (**Kg-cm**). The selected measuring unit is displayed right side of the display.

Press the **U/S** to switch between measuring units.

SELECTING TRACK / PEAK MODE

The DTF can display torque in **TRACK** or **PEAK** mode. When in **track** mode the torque wrench will display the target torque while there is no torque applied, when torque is applied the torque wrench will display real-time torque value until pressure is removed, then the display will show the target value. In peak mode the torque wrench will display the target torque while there is no pressure applied, when pressure is applied the torque wrench will display and hold the highest value measured until pressure is removed from the torque wrench then applied again or the **C** (zero) key is pressed.

To select **TRACK** or **PEAK** mode press and hold the **U/S** key for 2 seconds, the display will show **MODE**, then press the up or down arrow key to select between **PEAK** or **TRACK** mode (indicated by a small P or T in the bottom right corner of the display). Then press the **U/S** key two times to confirm your selection and return to measurement mode.

SETTING TARGET TORQUE

The DTF can store 9 preset target torque values. The preset value is displayed in the screen after **C** is pressed. Press the UP / DOWN arrow keys to set the target value. To switch between the 9 presets, press the **M** key. The preset number is displayed in the bottom right of the display next to the letter M. The preset will save both target torque and unit of measure when the screwdriver is powered off.

TARGET TORQUE INDICATION

The DTF torque wrench will alert you to reaching 90% of the target value by an audible beep and a green LED light. When you reach 100% the beep will change to a steady tone. When the torque applied is greater than the target a red light will illuminate above the green.

MEMORY

The DTF can store up to 50 readings in memory for recall on the display.

To store a reading in memory set the screwdriver to **P** (peak) mode and take a reading. When the reading is on the display press the **M** key to store the reading and zero the screwdriver.

To recall stored readings press and hold the **U/S** key for 2 seconds, the display will show **MODE**, then press **U/S** key one time, the display will alternate between **n0XX** (XX = the reading number) and the stored reading. Press the up / down arrows to toggle between readings. Press the **U/S** key twice to return to measurement mode.

To clear the stored readings press and hold the **U/S** key for 2 seconds, the display will show **MODE**, then press **U/S** key two times. **CLr** will be shown on the display. Press the **C** key twice to confirm the deletion of the readings. **WARNING**, this procedure will delete the entire contents of the memory, it is not possible to delete individual readings.

MAINTENANCE AND STORAGE

1. Do not Over-torque (105% of Max. torque capacity). Over-torqueing can damage torque wrench or cause it to lose accuracy.
2. If Er0 is displayed when the wrench is powered on, it indicates that it has been overloaded and should be returned to the factory for service.
3. Remove battery when storing for long period of time.
4. Do not use this torque wrench as a hammer.
5. Do not expose to excessive heat, humidity, or direct sunlight.
6. Do not use the torque wrench near water.

-
7. If the torque wrench gets wet, wipe it with a dry towel as soon as possible. The saltwater can be especially damaging.
 8. Do not use organic solvents, such as alcohol or paint thinner when cleaning the torque wrench.
 9. Keep this torque wrench away from magnets.
 10. Do not expose this torque wrench to dust or sand as this could cause serious damage.
 11. Do not apply excessive force to the LCD panel.

CALIBRATION

We recommended annual calibration of the DTF Torque wrench to ensure it is measuring according to factory specifications. For calibration service please return to:

ELECTROMATIC Equipment Co., Inc.
Attn Calibration Department
600 Oakland Ave
Cedarhurst, NY 11516

Please visit www.checkline.com/repair for complete instructions and services rates.

WARRANTY

ELECTROMATIC Equip't Co., Inc. expressly warrants to its buyer for one (1) year from the date of delivery that the goods sold are free from defects in workmanship and materials. ELECTROMATIC Equip't Co., Inc. will, at its option, repair or replace or refund the purchase price of goods found to be defective. This remedy shall be the buyer's sole and exclusive remedy. Any modification, abuse, exposure to corrosive environment or use other than intended will void this warranty. This warranty is in lieu of all other warranties, including implied warranties of merchantability and fitness for an intended purpose. In no event shall ELECTROMATIC Equip't Co., Inc. be liable for any incidental and consequential damages in connection with goods sold or any part thereof.



ELECTROMATIC Equip't Co., Inc.

600 Oakland Ave.
Cedarhurst, NY 11516

Tel: 800-645-4330 / 516-295-4300

Fax: 516-295-4399

Email: info@checkline.com

Website: www.checkline.com